



Strada provinciale SONCINESE km 10
24050 GHISALBA (BERGAMO)
Telephone: (0039)-0363-940011
Fax: (0039)-0363-940247

BOX L2/34.3 (H5)

* SPECIAL CHARACTERISTICS

Table Date
01-06-12

Code N° 3888



Rev. 32

Date 01-06-12

General tolerances for plastics material		
WHEN IS NOT OTHERWISE SPECIFIED		±
from 1 to 5	5	0.1
from 5 to 10	10	0.2
from 10 to 50	50	0.3
from 50 to 100	100	0.4
from 100 to 200	200	0.6
from 200 to 300	300	0.8
from 300 to 500	500	1.5
from 500 to 1000	1000	2.0

This drawing is an ACCUMA S.p.A. ownership. Without authorization it is forbidden to copy, to show to other people or to build the represented product. ACCUMA S.p.A. will reserve oneself to safeguard its rights according to law.

2 i

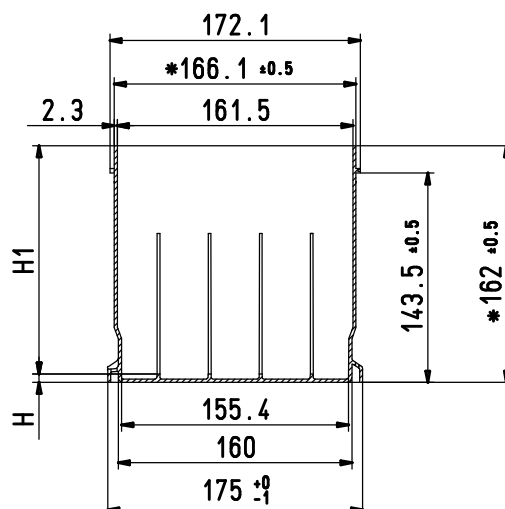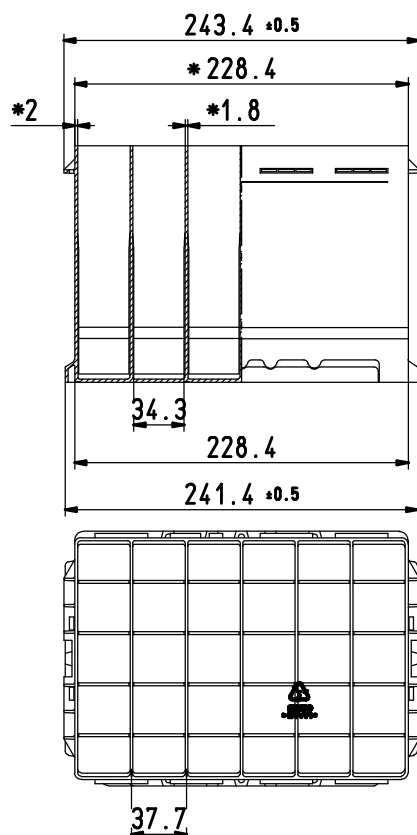

PRISMS

H	H1
0	159.7
3.5	156.2
6.6	153.1


TAB 902 LOWER PART POSSIBLE VERSIONS

102	L.S. 10.5DIN 3+3 NOTCHES SAME LENGTH	S.S. 10.5DIN 3+3 NOTCHES
148	L.S. 10.5DIN 5+5 NOTCHES SHORT+LONG	S.S. 10.5DIN 3+3 NOTCHES
199	L.S. 10.5 DIN 3+3 NOTCHES SHORT+LONG	S.S. 10.5DIN 3+3 NOTCHES
202	L.S. 10.5DIN 3+3 NOTCHES SAME LENGTH	S.S. WITHOUT
248	L.S. 10.5DIN 5+5 NOTCHES SHORT+LONG	S.S. WITHOUT
251	L.S. 9.7 EGY SAME LENGTH	S.S. WITHOUT
284	L.S. 19 DIN 3+3 NOTCHES SHORT+LONG	S.S. WITHOUT
285	L.S. 19 DIN 5+5 NOTCHES SHORT+LONG	S.S. WITHOUT
299	L.S. 10.5 DIN 3+3 NOTCHES SHORT+LONG	S.S. WITHOUT


TAB 903 UPPER PART POSSIBLE VERSIONS

246	WITH ROBOT RIBS (INTERRUPTED 4+5 +ONE LEVEL LINES)+L.L. , VW HANDLES
219	WITH ROBOT RIBS (INTERRUPTED 4+5 +ONE LEVEL LINES)+L.L. , WITHOUT HANDLES

10.5 DIN 3+3 SAME LENGTH FRONT AND BACK SIDE



10.5 DIN 3+3 FRONT SIDE



10.5 DIN 3+3 BACK SIDE



10.5 DIN 5+5 FRONT SIDE



10.5 DIN 5+5 BACK SIDE



19 DIN 3+3 FRONT SIDE




19 DIN 3+3 BACK SIDE




19 DIN 5+5 FRONT SIDE



19 DIN 5+5 BACK SIDE




9.7 EGY FRONT AND BACK SIDE



DIN 10.5 3+3 SHORT SIDE



WITHOUT SHORT SIDE




WITHOUT SHORT SIDE




WITHOUT SHORT SIDE




ROBOT RIBS INTERRUPTED 4+5, + LL
FRONT SIDE




BACK SIDE



VW HANDLES



WITHOUT HANDLES



246

219